

## G. RECOMENDACIÓN AL SECRETARIO

Departamento de Educación  
Dr. Eligio Hernández Pérez  
Secretario de Educación

Hora: 5 p.m.

Código:

63024 (DE)

N/A 0635 (AED)

Escuela: Manuel Elizalde

Fecha de  
Inspección:

07 - ENERO - 20

Municipio: San Juan

Abrir Escuela (Verde)

Abrir Parcialmente la Escuela (Amarillo)

No Abrir la Escuela (Rojo)

### Comentarios:

Verde se refiere a que no se observaron daños estructurales severos; Amarillo se refiere a que se observaron algunos daños estructurales, que requieren atención; Rojo se refiere a que la estructura evidencia daños estructurales significativos.

It should be noted that, as requested, this report is based solely on a visual inspection of the as-is facility for the purpose of assessing the presence of significant structural damage resulting from the seismic event since January 07, 2020 which may affect its structural condition compared to that prior to the seismic event.

The determination of the structural adequacy of the existing facility to meet the applicable design and construction building codes requirements as well as developing recommendations for the rehabilitation of the facility will require a more extensive investigation than that one requested to be conducted and reported herein.

Colvmo Extenion de Estructura Principal en la Zone Comprometido  
a Causa de corrosion. ESTE Representa un Riesgo Mayor a  
la Estabilidad de la Estructura. No Presente daños a  
Cama de los terremotos. La Navea tiene  
misma condicions.

Jose R. Gaya Gil  
Nombre (Letra de Molde)

Firma



## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### A. GENERAL INFORMATION

1. Street Address of the school: Calle Madison Res. Las Casas  
City: San Juan State: Puerto Rico Zip: \_\_\_\_\_
2. School Name: Manuel Elzaburu y Vizcarrondo
3. Date of inspection: 17 de enero de 2020
4. Inspector's Name: José A. Cora Rodríguez / José Gaya Gil - Supervisor / Raul Gaya - Inspector

### B. BUILDING SITE INSPECTION

*Revised 3/Feb/2020*

#### 5. Utility Service Safety:

IMPORTANT—Immediately following an earthquake, check the entire property, especially near appliances, for the smell of gas. If gas odor is detected, turn off the gas at the meter where it enters the house. Locate and repair leaks before turning gas back on. If the gas odor persists after the gas has been shut off, vacate the building and contact the gas utility company immediately.

IMPORTANT—Before entering a damaged, vacant building verify that gas is off. Check the gas meter for damage and position of main gas valve, either a manual valve or a seismically activated gas shut-off valve. Do not enter the building if gas odor is detected.

- a. Odor of natural gas leakage?  YES  NO      b. Downed powerlines?  YES  NO

#### 6. Surrounding topography: (check one)

- Flat
- Gently sloping (easily walkable)
- Steeply sloping (difficult or impossible to walk in some areas)

#### 7. Building pad: (check one)

- Flat
- Terraced or multilevel
- Gently sloping (less than 4-foot ground surface elevation difference across house)
- Steeply sloping (greater than 4-foot ground surface elevation difference across house)

#### 8. Geotechnical Issues: (if yes, provide description and photos)

- |   | YES                      | NO                                  |
|---|--------------------------|-------------------------------------|
| a. New cracks in the ground?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| b. Signs of fresh cracking in or movement of hardscape?   | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| c. Signs of fresh cracking in or movement of retaining walls?                                     | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| d. Patterns of cracking that extend through the ground surface, hardscape, and improvements?      | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| e. Evidence of sand boils or other fresh-appearing deposits of sand or mud?                       | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| f. Unusual slumping, rising, or bulging of the ground surface?                                    | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| g. Evidence of rock falls or slope instability above site?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| h. Ground movement or wet areas indicating possible broken underground utility lines?             | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
| i. Other phenomena (e.g., septic tanks surfacing, differential settlement, ground consolidation)? | <input type="checkbox"/> | <input checked="" type="checkbox"/> |

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### B. BUILDING SITE INSPECTION (continued)

YES      NO

9. Evidence of earthquake-induced permanent ground deformation in the immediate vicinity of the property?

### C. GENERAL BUILDING INFORMATION

10. Safety Assessment Tag: (check one)  None  Green  Yellow  Red

(others):  Yellow  Red

11. a) Year of original construction (best estimate): \_\_\_\_\_  
 b) Total square footage (best estimate): \_\_\_\_\_

12. Have any repairs, modifications, or demolition been performed since the earthquake?

YES      NO

If yes, describe \_\_\_\_\_

13. Building configuration:

- a. Single story
- b. Combination one and two story
- c. Full two story
- d. Three story
- e. Split level
- f. Typical
- g. Other, describe \_\_\_\_\_

14. Exterior wall finish:

- a. Stucco
- b. Panel siding
- c. Metal siding
- d. Masonry veneer
- e. Other, describe \_\_\_\_\_

15. Foundation configuration:

- a. Slab-on-grade
- b. Crawlspace without cripple walls
- c. Crawlspace with cripple walls
- d. Exposed piers or posts
- e. Typical
- f. Metal
- g. Other, describe Pilotes \_\_\_\_\_

16. Sill bolting:

- a. Structure bolted to foundation
- b. Structure not bolted to foundation
- c. Don't know

17. Roof configuration:

- a. Gable
- b. Hip
- c. Flat or very low slope
- d. Shed
- e. Other, describe \_\_\_\_\_

18. Roof covering:

- a. Asphaltic membrane
- b. Wood shingle or shake
- c. Concrete
- d. Metal
- e. Elastomeric
- f. Other, describe \_\_\_\_\_

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### D. EXTERIOR BUILDING INSPECTION

	YES	NO	N/A
<b>19. General: (if yes, provide description and photos)</b>			
a. Collapse, partial collapse, or building off foundation?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
b. Obvious lean in any story?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
<b>20. Exterior walls: (if yes, provide description and photos)</b>			
a. Fresh cracking at corners of door and window openings?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b. Fresh cracking at building corners?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c. Door or window openings racked out of square?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d. Broken glass in windows or doors?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. Wall leaning?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
f. Bulging or delamination of stucco?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
g. Pattern of cracking that extends from the ground surface, through foundation, and wall?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
h. Evidence of recent relative movement at mudsill line?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
i. At locations where the exterior stucco is continuous from the framing down over the foundation, is there cracking of stucco along the mudsill level accompanied by indications of permanent displacement (sliding) of the building relative to the foundation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
j. Collapse, partial collapse, or separation of masonry veneer?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
k. Severe cracking, separations, or offsets at building irregularities?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<b>21. Foundation: (if yes, provide description and photos)</b>			
a. Fresh cracking of exposed perimeter foundation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
b. Relative movement between slab and footing in "two-pour" slab-on-grade foundations?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c. Ask homeowner if any earthquake retrofits have been done to the home?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
If Y describe: _____			
d. If the answer to c is Y, were bolts added to connect the home to the foundation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. If the answer to c is Y, were plywood or sheathing added to any cripple walls under the home?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### D. EXTERIOR BUILDING INSPECTION (continued)

		YES	NO	N/A
<b>22. Kitchen Hook (if yes, provide description and photos)</b>				
a. Present on external wall?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b. Present at internal location?		<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
c. Collapse or partial collapse?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d. Visible damage or cracking?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. Visible tilting or separation from building?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
f. Shifted or loose and displaced		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
g. Deterioration or deformation		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<b>23. Roof: (if yes, provide description and photos)</b>				
a. Shifted or dislodged or concrete damage?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b. Impact damage to roof from falling object?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c. Displaced rooftop HVAC units?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d. Significantly sagging roof ridgelines?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. Signs of movement between rafter tails and wall finishes at eaves?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
f. . Buckled/dislodged flashing or tearing of roof membrane, roof/wall intersections in split level buildings, additions, or other building irregularities?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
g. Tearing of roof membrane or deck waterproofing at re-entrant corners?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
h. Toppling, shifting, or damage/leakage at refrigerant and electrical lines of rooftop mechanical equipment?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
i. Shifting of or damage to solar panels?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### D. EXTERIOR BUILDING INSPECTION (continued)

- |  |                          |                                     |                          |
|--|--------------------------|-------------------------------------|--------------------------|
| 24. Attached or abutting improvements: (if yes, provide description and photos)  | YES                      | NO                                  | N/A                      |
| a. Collapse, partial collapse, or separation of attached porches, carports, Gazebos, or awnings?   | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| b. Evidence of recent settlement or displacement of exterior steps, patios, or walkways relative to the building?                            | <input type="checkbox"/> | <input checked="" type="checkbox"/> |                          |
| c. Signs of movement between building floor and/ or exterior hardscape or retaining wall along the uphill side of non steeply sloping sites? | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| d. Toppling, shifting, or damage/leakage at refrigerant and electrical lines of air conditioning condenser unit(s)?                          | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| <br>   |                          |                                     |                          |
| 25. Independent exterior improvements: (if yes, provide description and photos)  |                          |                                     |                          |
| a. Damaged detached gazebo?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| b. Damage to fences / privacy walls?   | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| c. Damage to retaining walls?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| d. Damage to walkway?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| e. Evidence of leakage from water supply lines?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| f. Toppling, shifting, or damage/leakage at fuel connection of propane tanks?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| g. Others damage   | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

### E. INTERIOR INSPECTION

#### 26. General information

- |  |   |
|--|---|
| a. If interior access not possible, identify reason                        | b. Typical wall and ceiling finish  |
| <input type="checkbox"/> i. Red tag  | <input checked="" type="checkbox"/> i. Drywall  |
| <input type="checkbox"/> ii. Hazardous materials                           | <input type="checkbox"/> ii. Plaster on gypsum lath                                   |
| <input type="checkbox"/> iii. Other hazardous condition,<br>describe _____ | <input type="checkbox"/> iii. Plaster on wood lath                                    |
| <input type="checkbox"/> iv. Other, describe _____                         | <input checked="" type="checkbox"/> iv. Other, describe <u>Plafón acustico.</u> _____ |

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### **E. INTERIOR INSPECTION (continued)**

		YES	NO	N/A
<b>27. Walls: (if yes, provide description and photos)</b>				
a. Fresh cracking, buckling, spalling, or detachment of interior wall finish at corners of door and window openings?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b. Fresh cracking of wall finishes at wall corners or wall/ceiling intersections?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c. Door or window openings racked out of square?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d. Wall leaning?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. Pattern of cracking that extends from the floor slab through the wall?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	
f. Movement or sliding of walls relative to the floor?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	
g. Severe cracking, separations, or offsets at building irregularities?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
h. Doors damaged, difficult to operate, or inoperable?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
i. Windows damaged, difficult to operate, or inoperable?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<b>28. Ceilings: (if yes, provide description and photos)</b>				
a. Collapse of ceiling finish?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b. Fresh cracking of ceiling finishes, especially at re-entrant corners; cracks along corner bead at stairwell openings; cracking or tearing of finishes at ceiling/wall juncture; or multiple "nail pops"?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c. Damage to ceiling finishes in vicinity of corridors or commons places?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d. Separations or cracks in ceiling finishes at split-levels, re-entrant corners, additions, appendages, or other building discontinuities?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e. Water damage or evidence of recent leakage from plumbing lines or roofing?		<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### **E. INTERIOR INSPECTION (continued)**

		YES	NO	N/A
29.	<b>Floors: (if yes, provide description and photos)</b>			
a.	Evidence of recent sloping, sagging, settlement or displacement of floors?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
b.	In slab-on-grade locations, fresh cracking of floor slab or floor finishes?	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
c.	Significant sagging or unusual bounciness of floors frames?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d.	Separations or cracks in floor finishes at split-levels, re-entrant corners, additions, appendages, or other building discontinuities?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
e.	Signs of movement between floor and exterior hardscape or retaining wall along the uphill side of homes on steeply sloping sites?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
f.	A pattern of fresh cracks, gaps, or joint separations in floor finishes?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
g.	Impact damage to floor finishes from falling contents?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
30.	<b>Mechanical systems: (if yes, provide description and photos)</b>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
a.	Displaced connection of appliance flues connected to chimneys?			
b.	Toppling, shifting, leakage from tank, leakage from water connections displaced flue connection or damage/leakage at gas line or electrical connection of water heater?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
c.	Shifting, damage/leakage at gas line, flue connection, electrical connection, refrigerant line, and condensate drain connection of furnace or air conditioning fan-coil unit?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
d.	Damage to gas line of gas stoves or gas fueled clothes dryers?			
e.	Damage to toilets?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
f.	Decreased or restricted water pressure at appliances, faucets, or toilets?			
g.	Toppling or shifting of free-standing wood stove and/or flue?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
h.	Toppling, shifting, damage/leakage at fuel connection of fuel oil tank?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
i.	Other Damage in the dining room	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
j.	Damage near the gas tank Desconocido.	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Where description is indicated, attach additional pages of notes and photographs keyed to appropriate checklist item.

### **E. INTERIOR INSPECTION (continued)**

- |   |                          |                                     |                          |
|---|--------------------------|-------------------------------------|--------------------------|
| 31. Architectural woodwork and special finishes: (if yes, provide description and photos)                                       | YES                      | NO                                  | N/A                      |
| a. Shifting of or damage to kitchen or bathroom cabinetry?  | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| b. Impact damage to countertops from falling objects?   | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| c. Cracking of ceramic tile in showers or tub/shower enclosures consistent with<br>earthquake damage to adjacent wall finishes? | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

### **F. CONTINGENT INSPECTIONS**

- |  |                          |                                     |                          |
|--|--------------------------|-------------------------------------|--------------------------|
| 32. Retaining Tank Wall damage?                      | YES                      | NO                                  | N/A                      |
| 33. Water tank or other field subterranean structure | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

**G. RECOMENDACIÓN AL SECRETARIO**

Departamento de Educación  
 Dr. Eligio Hernández Pérez  
 Secretario de Educación

Hora: 5:00pm

Código: 63024 (DE) 8635(AED)

Escuela: Esc. Manuel Elzaburu y Vizcarrondo

Fecha de  
 Inspección: 17 de enero de 2020

Municipio: San Juan, PR.

Abrir Escuela (Verde)

Abrir Parcialmente la Escuela (Amarillo)

No Abrir la Escuela (Rojo)

Nota: Verde se refiere a que no se observaron daños estructurales severos; Amarillo se refiere a que se observaron algunos daños estructurales, que requieren atención; Rojo se refiere a que la estructura evidencia daños estructurales significativos.

It should be noted that, as requested, this report is based solely on a visual inspection of the as-is facility for the purpose of assessing the presence of significant structural damage resulting from the seismic event since January 07, 2020 which may affect its structural condition compared to that prior to the seismic event.

The determination of the structural adequacy of the existing facility to meet the applicable design and construction building codes requirements as well as developing recommendations for the rehabilitation of the facility will require a more extensive investigation than that one requested to be conducted and reported herein.

No se encontró daño estructural luego del terremoto a la fecha de inspección del 17 de enero de 2020 hora 5:00pm. No obstante en la base de columna de acero de la estructura principal se observó un serio deterioro por corrosión en dicha sección. Esta condición preexistente compromete la estabilidad y seguridad de la estructura en un evento sísmico o de viento. Por lo que se recomienda el cierre de este plantel hasta que se realice dicha reparación.

Comentarios: 1. Estructura de construcción compuesta de acero estructural, hormigón reforzado y bloques. Soportada sobre pilotes y "mat foundation"

2. Grieta en pared de bloque localizada en cuarto de cisterna construido debajo de rampa de acceso. Dicha construcción fue realizada posteriormente a la construcción original de la estructura. Condición preexistente. Se recomienda reparar el empaquetado. Ver foto IMG\_3178 y IMG\_3177.

3. Techo galvalum. Condición preexistente. Ver foto IMG\_3240.

4. Base de columna de acero corroída localizada en esquina de estructura principal. Condición preexistente. No relacionado con el terremoto. Se recomienda reparar y reforzar la sección. Ver foto IMG\_3227 y IMG\_3234.

5. Filtraciones de techo salón Eugenio. Condición preexistente.

6. Asientos de cancha. Presentan condición de acero de refuerzo corroído expuesto. Condición preexistente.


## GENERAL EARTHQUAKE DAMAGE INSPECTION CHECKLIST

Ver foto IMG\_3517.

7. Cancha bajo techo. A) Bases de columnas de acero estructural seriamente corroídas. Ver foto IMG\_3539. B) Viga en techo en cantiléver. En las conexiones atornilladas se observan serios daños por corrosión lo cual están ocasionando el desplome del techo. Por las condiciones de daños por corrosión al acero recomendamos por seguridad el cierre de esta área. Indicamos que estos son condiciones preexistentes no relacionadas con el terremoto. Ver foto IMG\_3532.

Notas generales: 1. Grietas generales en el empañetado en paredes de bloque en la parte superior donde conecta con las vigas y en la conexión de las paredes de bloques con las columnas. Se recomienda reparación del empañetado. 2. Filtraciones de techo y entre pisos intermedios. Condición preexistente. No relacionado con el terremoto. 3. Juntas de expansión. Observamos que están en deterioro. Las mismas deben revisarse y en las juntas empañetadas en plafón de encontrar material de cemento suelto debe removese por seguridad. 4. Recomendamos verificar y probar las líneas de gas en cocinas y sistemas de control de incendios en los planteles antes de comenzar las clases.

Comentarios adicionales ver adjunto:

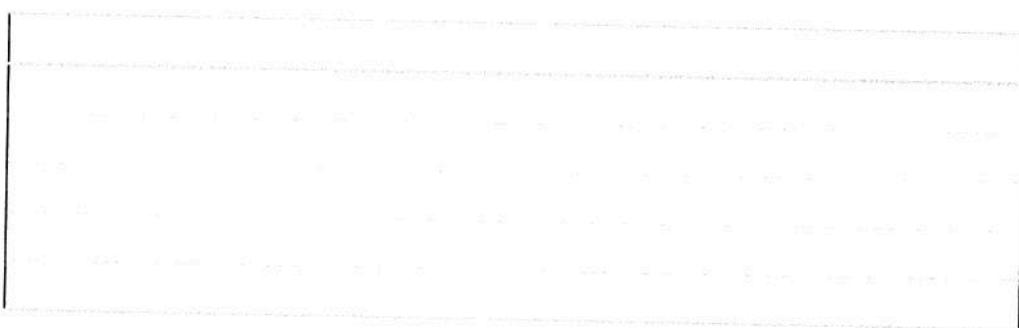


José Gaya Gil  
Nombre (Letra de Molde)


Firma

19679  
# Licencia

Sello

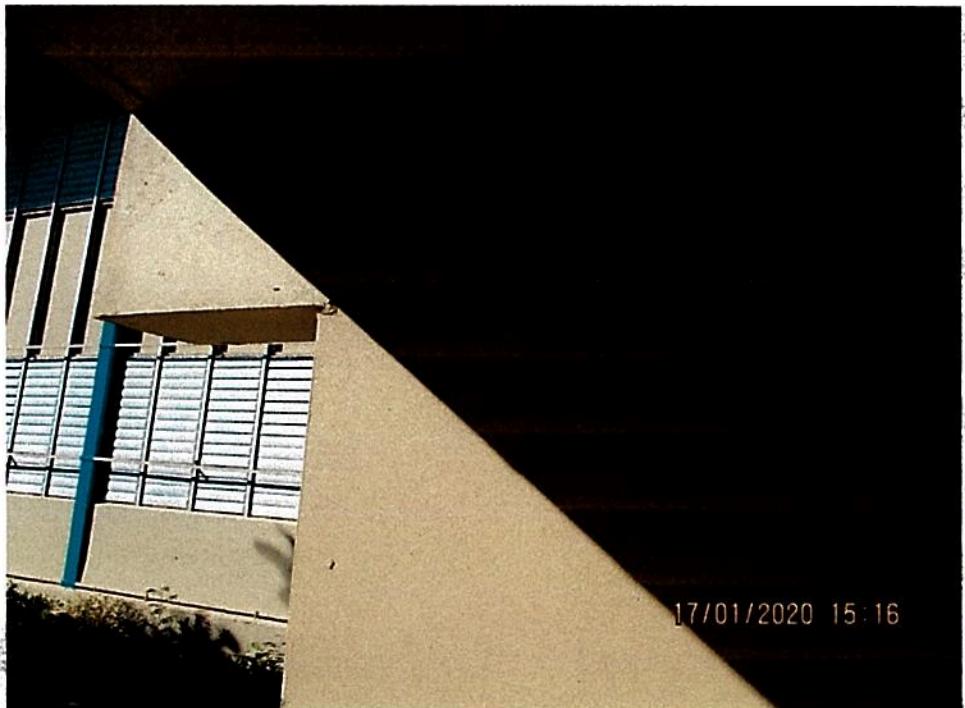

IMG\_3177

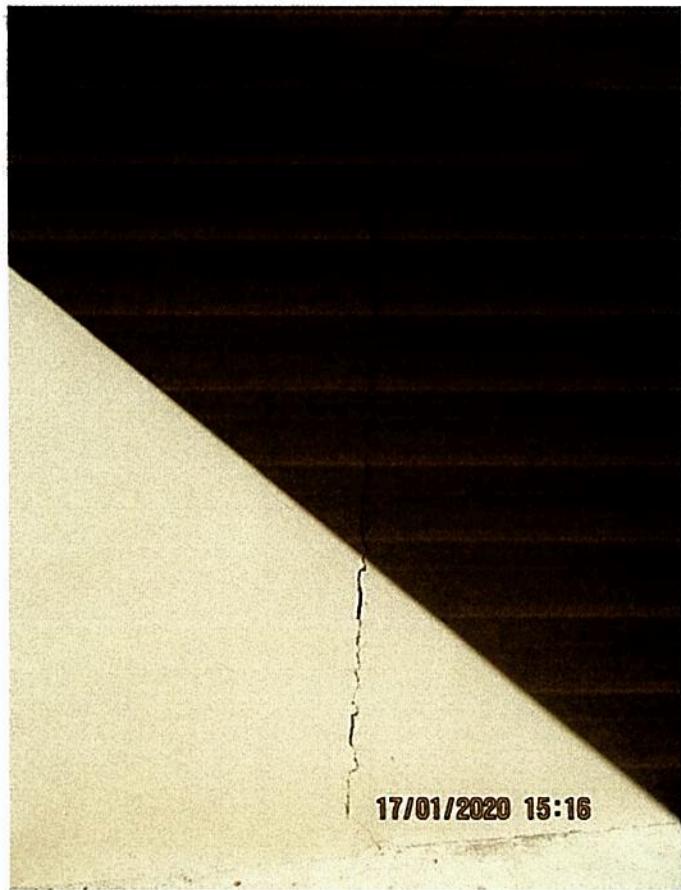

IMG\_3178




IMG\_3227



17/01/2020 15:31

IMG\_3234

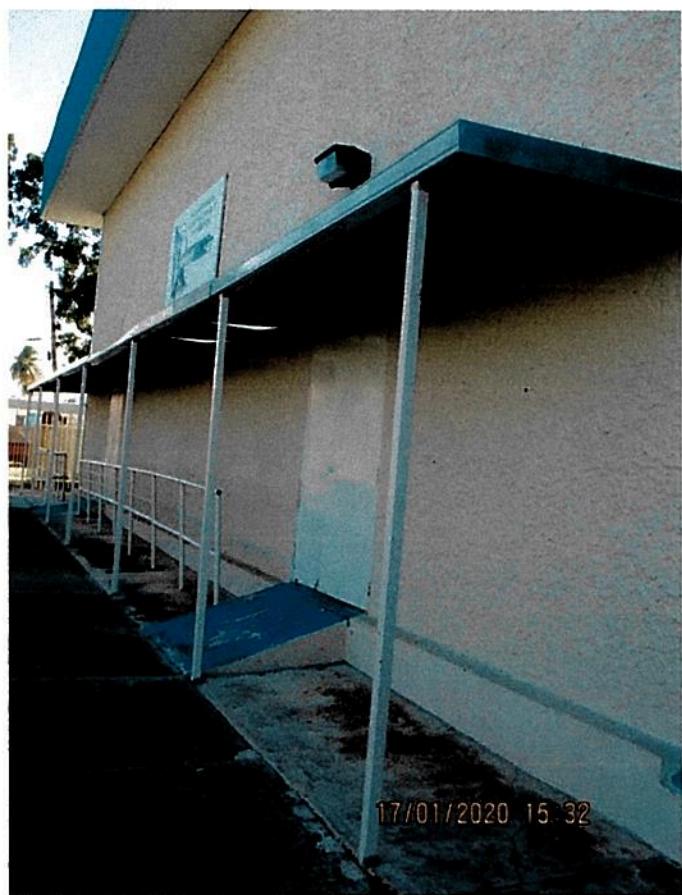

IMG\_3240



IMG\_3517



IMG\_3532



IMG\_3539



COLEGIO DE INGENIEROS Y AGRIMENSORES  
DE PUERTO RICO

PO Box 363845 \* San Juan, Puerto Rico \* 00936-3845  
Tel. 787-758-2250 \* Fax. 787-758-7639

ESTAMPILLA DIGITAL ESPECIAL (EDE)

Ing. José R. Gaya Gil, PE



Práctica de: Ingeniería  
Licencia: 19679  
Renglón: Documento  
Descripción del Trabajo: Inspección y Verificación de Instalaciones  
Fecha de Emisión: 2020-01-24  
Monto Emitido: \$5  
Número de Serie: 0173-7947-0221-0740  
Número de Caso: 10  
Proyecto / Unidad: Escuela Manuel Elzaburu  
Rol del Profesional: Consultor

Certificación:

El profesional certifica con la emisión de la estampilla digital especial del Colegio de Ingenieros y Agrimensores de Puerto Rico el haber cumplido con las disposiciones de la Sección 11 de la Ley 319 del 15 de mayo de 1938, según enmendada.

*La colocación del sello profesional constituye la cancelación de la estampilla digital especial*